



SERVICE PLUS TECHNICAL BULLETIN

Manufacturer: Ford

Service Plus Group: 07-06-0405

Subject: Hesitation During Hard Sweeping Right Turns

Model: 2002 Explorer / 2002 Mountaineer

A hesitation while making hard sweeping right hand turns (such as highway on-ramp) may be felt on some vehicles. This condition may be due to fuel pump cavitation, as a result of fuel sloshing away from filter sock in the fuel tank. It may be necessary to replace the fuel pump/sender assembly. Refer to the following Service Procedures.

1. If a fuel pressure drop is verified, replace the fuel pump/sender assembly.
2. If the fuel pressure does not drop, DO NOT replace the fuel pump. Proceed with Diagnostics.

Part Number	Part Name
1L2Z-9H307-KD	Fuel Pump - North American 4.0L w/5R55W Automatic Transmission
1L2Z-9H307-LC	Fuel Pump - All 4.6, All 4.0L w/Manual Transmissions, and All Export Units

NOTE Refer to appropriate Ford Service Information for all repairs.