



Total Car Care Technical Service Bulletins



Manufacturer: Honda (TSB #06-060)

TCC Group: 09-22-0311

Subject: Rattle or Knock From Right-Front of Vehicle When Driving Over Bumps

Models Affected:

<p><i>Cavitating Engine Mount:</i></p> <ul style="list-style-type: none">• 2006 Civic 2 Door -All• 2006 Civic Si 2 Door - All• 2006 Civic 4 Door (Except Hybrid) From VIN JHMFA1....6S000001 thru JHMFA1.... 6S010546 From VIN 1HGFA1...6L000001 thru 1HGFA1...6L147776 From VIN 2HGFA1,,,6H500001 thru 2HGFA1.. 6H527690 <ul style="list-style-type: none">• 2006 Civic GX - All	<ul style="list-style-type: none">• 2007 Civic 2 Door From VIN 2HGFG1...7H500001 thru 2HGFG1...7H523370 • 2007 Civic Si 2 Door From VIN 2HGFG2...7H700001 thru 2HGFG2...7H703108 • 2007 Civic Si 4 Door From VIN 2HGFA5...7H700001 thru 2HGFA5...7H702700 <p><i>Torn Engine Mount:</i></p> <ul style="list-style-type: none">• 2006-2010 Civic (except Hybrid) - All
---	---

Symptom:

There is a rattle or knock coming from the right-front of the vehicle when driving over bump at 15 to 20 mph (24 to 32 km/h).

Probable Cause:

The passenger's side hydraulic side engine mount is cavitating and making a rattling sound, or it is torn and making a knocking sound.

Corrective Action:

Replace the side engine mount.

CONTINUED...



Total Car Care Technical Service Bulletins



Parts Information:

Flange Bolt (12x35mm):

Part # 90168-S5A-000

Flange Bolt (12x97mm):

Part # 90165-S04-000

Flange Nut (14mm):

Part # 90213-S5A-003

Hydraulic Side Engine Mount (Rubber Assembly):

All 2 Door except Si- Part # 50820-SNB-305

All 2 Door and 4 Door Si - Part # 50820-SNG-J02

All 4 Door except Si - Part # 50820-SNA-033

Tool Information:

Diagnostic Spacer:

Tool # 07AAJ-SNAA110