



# TOTAL CAR CARE SERVICES

## TECHNICAL SERVICE BULLETINS

**Manufacturer:** Lexus

**TCC Group:** 01 -13 -0315

**Subject:** Oil Cooler Pipe Leak/Seep

**Model:** 2007-2011 RX350; 2010-2011 RX450H

**Issue:** Some 2007-2011 model year RX 350 and 2010-2011 model year RX 450h vehicles may exhibit a leak or oil seep from the engine oil cooler pipes. Follow the repair procedure in this bulletin to address this condition.

### Production Change Information:

MODEL	PLANT	DRIVETRAIN	PRODUCTION CHANGE EFFECITVE VIN
	TMK	2WD	JTJZK1#A#B2411960
			JTJGK31U#B9853261
		AWD	JTJBK1#A#B2438248
			JTJHK31U#B2859501
	TMMC	2WD	2T2ZK1BA#BC071028
			2T2GK31U#BC082087
		AWD	2T2BK1BA#BC132757
			2T2HK31U#BC135374
RX 450h	TMK	AWD	JTJBC1#A#B2420235

**Continued...**



# TOTAL CAR CARE SERVICES

## TECHNICAL SERVICE BULLETINS

Manufacturer: Lexus (TSB-L-SB-0154-11)  
 TCC Group: 01 -13 -0315

### Parts Information

PART NUMBER		PART NAME	QTY.
PREVIOUS	NEW		
15767-31010 15767-31020	04004-29131	Pipe, Oil Cooler Kit*	1

\*See table below for the list of the parts included in the Oil Cooler Pipe Kit.

OIL COOLER PIPE KIT CONTENTS	
PART NUMBER	PART NAME
15767-31020	Pipe, Oil Cooler
11496-31010	Gasket, Oil Hole Cover
15785-31010	Gasket, Oil Cooler

### Repair Information

1. Confirm the leak or seep is from either of the oil cooler pipes. If neither oil cooler pipe is leaking or seeping, this bulletin does NOT apply.
2. Remove and replace the oil cooler pipe assembly.
3. Confirm the engine oil level is correct.
4. Start the engine and confirm there's no leaking or seeping from the oil cooler pipes.

