



TOTAL CAR CARE SERVICES

TECHNICAL SERVICE BULLETINS

Manufacturer: Chevrolet

TCC Group: 07 -40 -0316

Subject: Engine Stall or Stumble


Attention: Vehicles equipped with 1.4L RPO LUJ/LUV turbocharged engine

Model: 2011 - 2014 Cruze

Issue: Engine stalls, stumbles, and/or has a hesitation when accelerating from a stop.

Cause: The ignition coil connector may have fretting on the terminals, causing a poor connection.

Action: Inspect the 7-pin coil pack connector for poor terminal contact or fretting. Replace connector with part number 19300958 if needed.

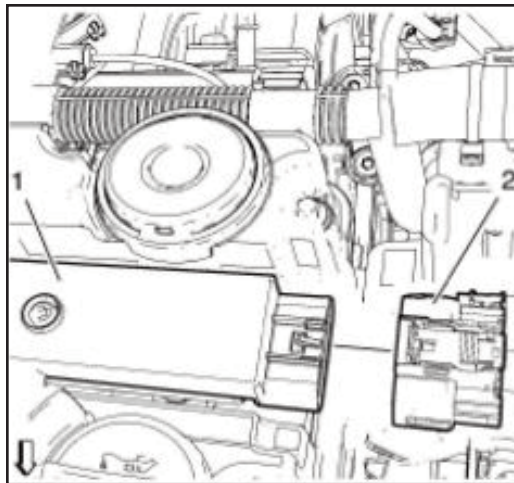

(1) Ignition coil and
(2) 7-pin ignition coil wiring harness connector