

## TCOM

62TE Sets Codes P0792 /P0734/ P0735.


Neutrals on 4-5 shift - then limp mode.

If you get a 62TE with these codes look for sealing ring wear in the low compounder drum. If you see any signs of wear its best to replace the drum with a new OE drum.

A new drum will have .019 - .020 clearance between the sealing ring and the ring land. **At this time there is no published wear limit and any wear is too much for sealing rings grooves.**

As of this writing the new drum Mopar part number is #68029389AA

Bad drum – Too much gap between rings and ring lands.

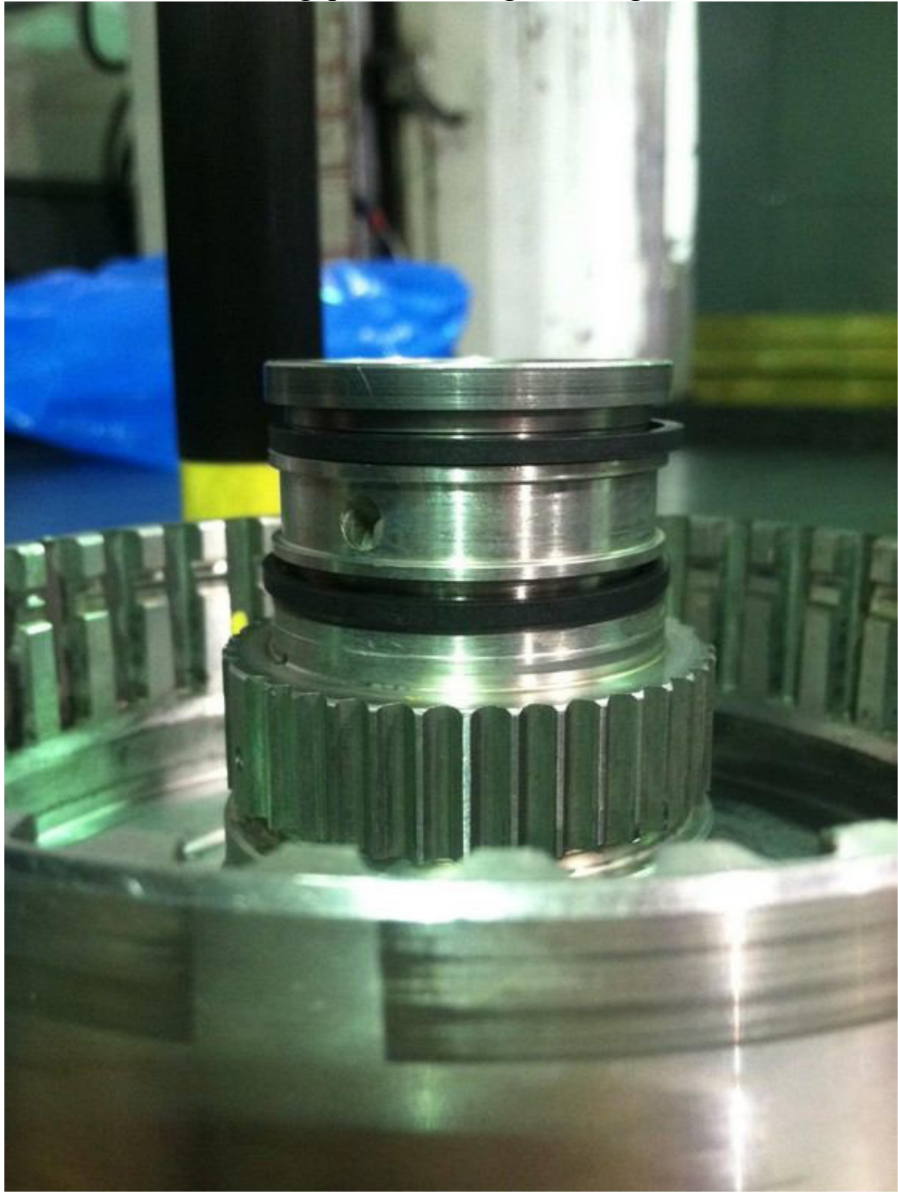

Bad drum. Top ring land is worn away.



New drum. Rings fit tight. .020 clearance when measured with a feeler gauge.

